
# 61329 FR Hi-Vis Coverall







Internal chest pocket for a radio with external opening so mic attaches to radio loop at the shoulder.

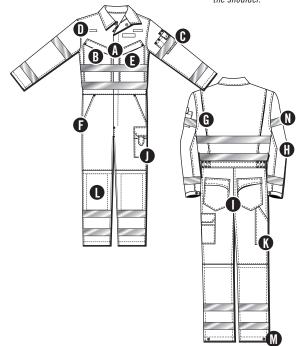

#### DESCRIPTION

This deluxe, high-visibility coverall fits great and features ten pockets and non-sparking YKK® zips throughout. The sleeves are designed with pre-bent elbows for a more contoured fit and ease of movement. 100% brass press studs are covered on the inside so nothing but soft, protective material comes in contact with your skin. Major seams are triple-stitched and stress points are bar-tacked for strength. Reflective striping is strategically placed for increased visibility and safety.

#### **FABRIC**

Daletec® (Quality 29)

Blend 74% Cotton, 24% Polyester, 2% Carbon

Finished Weight 8.5 oz/yd<sup>2</sup> (290 g/m<sup>2</sup>)

Weave Sateen 4/1

#### **STANDARDS**



Flame Resistant (EN ISO 11612)



Electric Arc Flash (EN 61482-1-2)



Anti-static (EN 1149-5)



**High Visibility** (EN ISO 20471, Class 3) (AS NZS 4602.1:2011, Class D/N)

#### **COLORS**

Hi-Vis Yellow / Night Blue (91) Hi-Vis Yellow / Red (87)

### SIZES

Short 32-70 Regular 32-70 Tall 32-70 Extra Tall 32-70

### **FEATURES**

- Concealed two-way, black high density polyester coil zips with brass snap closure
- Two chest pockets with zip closure and storm flaps
- (C) Sleeve pocket for mobile phone and pen
- Two radio loops at shoulders
- Internal chest pocket for radio with hook-and-loop closure (E)
- (F) Two side pockets with hidden exterior-to-interior access through pocket lining
- (G) Large pleats in the back for freedom of movement and comfort
- (H) Sleeves with pre-bent elbows for ease of movement
- Two back pockets, one with flap (right) (I)
- (J) Cargo pocket with mobile phone and pen pocket on left leg
- (K) Ruler and tool pocket on right leg
- External knee pad pockets (knee pads sold separately)
- Concealed YKK® brass press studs throughout
- 2" (50mm) wide reflective FR double striping around arms, legs and body

## WASHING AND CARE INSTRUCTIONS

Do not use acids or sour rinse.



Machine wash: max 60° C / 140° F



Iron: medium heat (max 150° C / 302° F)

P Dry clean: any solvent except trichloroethylene

Tumble dry: low heat